

Programmable Multi-Axis Controller

Startup Guide EtherCAT Coupler Unit Digital I/O Unit (IDEv4)

CK3E-□□□□ CK3M-CPU1□1 NY51□-A□□□



O041-E1-01

About Copyrights and Trademarks

Microsoft product screen shots are reprinted with permission from Microsoft Corporation.

Windows is a registered trademark of Microsoft Corporation in the United States and other countries.

EtherCAT® is a patented technology and registered trademark licensed by Beckhoff Automation GmbH, Germany.

Sysmac is a trademark or registered trademark of OMRON Corporation in Japan and other countries for OMRON factory automation products.

Company names and product names in this document are trademarks or registered trademarks of their respective companies.

Contents

1.	Related Manuals	4
2.	Terms and Definitions	5
3.	Precautions	6
4.	Overview	7
5.	Applicable Devices and Device Configuration	8
5.1.	Applicable Devices	8
5.2.	Device Configuration	9
6.	EtherCAT Connection Procedure	10
6.1.	Workflow	10
6.2.	Preparation for the Controller Setup	11
6.3.	Installation of ESI Files	16
6.4.	EtherCAT Communications Setup	16
6.5.	Controller Settings	25
7.	Appendix Saving and Loading a Project	30
7.1.	Saving a Project	
7.2.	Loading and Downloading a Project	32
8.	Appendix Troubleshooting	35
8.1.	Factors Causing EtherCAT Communications To Be Unavai	lable, and Corrective Actions
		35
8.2.	How to Check for Errors	36
9.	Appendix ECAT[i] Structure Elements	39
10	Revision History	40

1. Related Manuals

To ensure system safety, always read and follow the information provided in all *Safety Precautions* and *Precautions for Safe Use* in the manuals for the devices that are used in the system.

The following shows the manuals for OMRON Corporation (hereafter referred to as OMRON) and Delta Tau Data Systems, Inc (DT).

Manufacturer	Manual No.	Model	Manual name
OMRON	I610-E1	Model CK3E-1□10	CK3E-series Programmable
			Multi-Axis Controller Hardware
			User's Manual
OMRON	O036-E1	Model CK3M-CPU1□1	CK3M-series Programmable
			Multi-Axis Controller
			Hardware User's Manual
OMRON	W580-E2	Model	Industrial PC Platform NY-series IPC
		NY512-A6001XX21391	Programmable Multi-Axis Controller
		X	Industrial Box PC Hardware User's
			Manual
OMRON	W519-E1	Model NX-ECC203	EtherCAT® Coupler Unit User's
			Manual
OMRON	W521-E1	Model NX-ID□□□□	Digital I/O Unit User's Manual
		Model NX-IA□□□□	
		Model NX-OC□□□□	
		Model NX-OD□□□□	
		Model NX-MD□□□□	
DT	O014-E	-	Power PMAC User's Manual
DT	O015-E	-	Power PMAC Software Reference
			Manual
DT	O016-E	-	Power PMAC IDE Users Manual

2. Terms and Definitions

Term	Explanation and Definition
Slave	Slaves are devices connected to EtherCAT. There are various types of
	slaves such as servo drivers handling position data and I/O terminals
	handling the bit signals.
Object	Represents information such as in-slave data and parameters.
PDO	One type of EtherCAT communications in which process data objects
communications	(PDOs) are used to exchange information cyclically and in realtime.
(Communications	This is also called "process data communications".
using Process Data	
Objects)	
PDO Mapping	The association of objects used for PDO communications.
PDO Entry	PDO entries are the pointers to individual objects used for PDO
	mapping.
ESI file	An ESI file contains information unique to the EtherCAT slaves in XML
(EtherCAT Slave	format.
Information file)	You can load ESI files into the Power PMAC IDE, to easily allocate
	slave process data and make other settings.
ENI file	An ENI file contains the network configuration information related to
(EtherCAT Network	EtherCAT slaves.
Information file)	
Power PMAC IDE	This computer software is used to configure the Controller, create user
	programs, and monitor the programs.
	PMAC is an acronym for Programmable Multi-Axis Controller.

3. Precautions

- (1) Understand the specifications of devices that are used in the system. Allow some margin for ratings and performance. Provide safety measures, such as for installing a safety circuit, in order to ensure safety and minimize the risk of abnormal occurrences.
- (2) To ensure system safety, always read and follow the information provided in all *Safety Precautions* and *Precautions for Safe Use* in the manuals for each device that is used in the system.
- (3) The user is encouraged to confirm the standards and regulations that the system must conform to.
- (4) It is prohibited to copy, reproduce, or distribute a part or the whole of this document without the permission of OMRON Corporation.
- (5) The information contained in this document is current as of April 2019. It is subject to change without prior notice for improvement purposes.

The following notations are used in this document.



Indicates a potentially hazardous situation which, if not avoided, may result in minor or moderate injury, or may result in serious injury or death. Additionally, there may be severe property damage.



Indicates a potentially hazardous situation which, if not avoided, may result in minor or moderate injury, or property damage.



Precautions for Correct Use

Precautions on what to do and what not to do to ensure correct operation and performance.



Additional Information

Additional information to read as required.

This information is provided to increase understanding or make operations easier.

Symbols



The filled circle symbol indicates operations that you must carry out.

The specific operation is shown in the circle and explained in text.

This example indicates a "general precaution" for something that you must carry out.

4. Overview

This document describes the procedures used to connect the OMRON High EtherCAT
Coupler Unit model NX-ECC203 (hereafter referred to as the Slave) using OMRON
Programmable Multi-Axis Controller model CK3E-□□□□/ CK3M-CPU1□1/NY51□-A□□
☐ (hereafter referred to as the Controller) and EtherCAT, as well as for checking the
connection.

Refer to *Section 6. EtherCAT Connection Procedure* to learn about the setting methods and key points to perform PDO communications via EtherCAT.

5. Applicable Devices and Device Configuration

5.1. Applicable Devices

The applicable devices are as follows:

Manufacturer	Name	Model
OMRON	Programmable Multi-Axis	Model CK3E-□□□□
	Controller	
OMRON	Programmable Multi-Axis	Model CK3M-CPU1□1
	Controller	
OMRON	Programmable Multi-Axis	Model NY51□-A□□□
	Controller Industrial Box PC	
OMRON	EtherCAT Coupler Unit	Model NX-ECC203
OMRON	Digital I/O Units	Model NX-ID□□□□
		Model NX-IA□□□□
		Model NX-OC□□□□
		Model NX-OD□□□□
		Model NX-MD□□□□



Precautions for Correct Use

Use model NX-ECC203 Version 1.5 or later for the EtherCAT Coupler Unit. Models NX-ECC201 and NX-ECC202 cannot be used.



Precautions for Correct Use

In this document, the devices with models and versions listed in *Section 5.2* are used as examples of applicable devices to describe the procedures to connect the devices and check their connections.

You cannot use devices with versions lower than the versions listed in Section 5.2.

To use the devices mentioned above with models not listed in *Section 5.2* or versions higher than those listed in *Section 5.2*, check the differences in the specifications by referring to the manuals before operating the devices.




Additional Information

This document describes the procedures to establish the network connections. It does not provide information on operations, installations, wiring methods, device functionalities, or device operations, which are not related to the connection procedures. For more information, refer to the manuals or contact your OMRON representative.

5.2. Device Configuration

The hardware components to reproduce the connection procedures in this document are as follows:

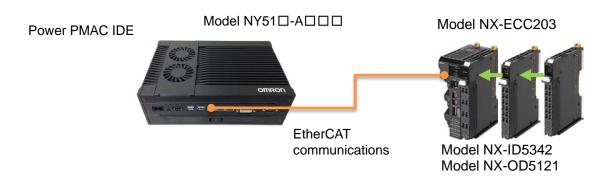

Manufacturer	Name	Model	Version
OMRON	Programmable Multi-Axis Controller	Model NY51□-A□□□	Ver.2.5 or later
OMRON	EtherCAT Coupler Unit	Model NX-ECC203	Ver.1.5
OMRON	Digital Input Unit	Model NX-ID5342	Ver.1.0
OMRON	Digital Output Unit	Model NX-OD5121	Ver.1.0
OMRON	Ethernet cable (with industrial Ethernet connector)	Model XS5W-T421-□M□-K	
DT	Power PMAC IDE	-	Ver.4.2.1.19



Precautions for Correct Use

Prepare the ESI file described in this section in advance. Contact your OMRON representative for information on how to procure the ESI file.



Precautions for Correct Use

Do not share the connection line of EtherCAT communications with other Ethernet networks. Do not use devices for Ethernet such as a switching hub.

Use the Ethernet cable (double shielding with aluminum tape and braiding) of Category 5 or higher, and use the shielded connector of Category 5 or higher.

Connect the cable shield to the connector hood at both ends of the cable.



Additional Information

This document describes model NY51 - A - as an example. The same procedures can apply to model CK3E- CK3M-CPU1 1.

6. EtherCAT Connection Procedure

This section describes the procedure for connecting the Controller with the Slave via EtherCAT. The description assumes that the Controller is set to factory default.

6.1. Workflow

Take the following steps to operate the PDO communications via EtherCAT after connecting the Controller with the Slave via EtherCAT.

6.2 Preparation for the Controller Setup	Prepare the Controller settings.
▼	'
6.2.1 Creation of a New Project	
6.2.2 Initial Settings of the Controller	
∇	
6.3 Installation of ESI Files	Install the ESI file for the Slave into
∇	Power PMAC IDE.
6.4 EtherCAT Communications Setup	Set up EtherCAT communications.
▼	
6.4.1 Communications Setup for the EtherCAT Master	
▼	
6.4.2 Distributed Clock Setup	
▼	
6.4.3 PDO Map Settings	
▼	
6.4.4 Creation of an EtherCAT Network Information	
File	
∇	1
6.5 Controller Settings	Set up the Controller.
▼	1
6.5.1 EtherCAT Communications Check	
▼	1
6.5.2 Writing the User Program	
▼	1
6.5.3 Project Data Transfer	

6.2. Preparation for the Controller Setup

Prepare the Controller settings.


Install Power PMAC IDE and Acontis EC-Engineer on the computer in advance.

6.2.1. Creation of a New Project


- Turn on the power to the Controller.
- Start Power PMAC IDE.
 - * If the dialog for confirming access rights appears upon start-up, select starting of Power PMAC IDE.




- The Communication screen appears. Specify the IP address of the destination Controller and click **Connect**.
 - * The IP address of the Controller is set to "192.168.0.200" by default.
 - * If necessary, change the Windows IP address to "192.168.0.X".

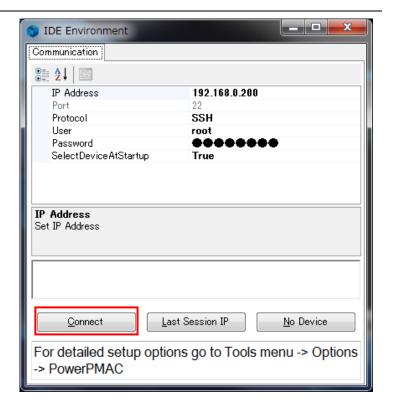


Power PMAC IDE starts, and is online to the Controller.

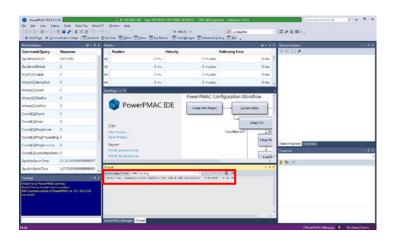

From the **File** menu, select **New** then **Project**.

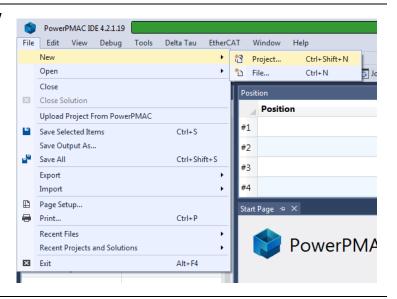

6 Enter a project name and location, and select **OK**.

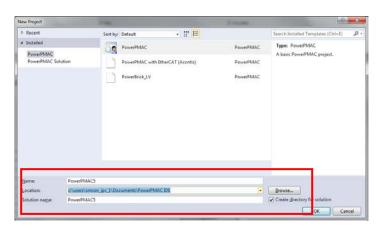

6.2.2. Initial Settings of the Controller


Configure the initial settings for the Controller.




Precautions for Correct Use

Configuring the initial settings clears all data in the Controller memory. Back up necessary data in advance.


1 In the Terminal tab page, type the \$\$\$*** command to reset the Controller to factory default.

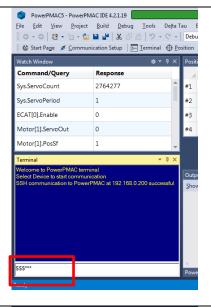

2 Select System – CPU – System in the Solution Explorer.

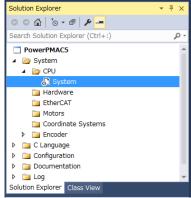


Select Global Clock.

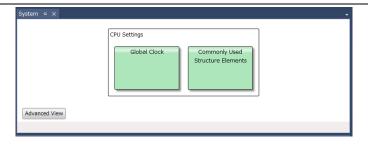




Select the **Servo Frequency** setting from 4 kHz, 2 kHz, or 1 kHz.


* Servo Frequency is set to 1 kHz for the example in this document.

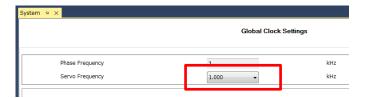

Click the **Accept** button.

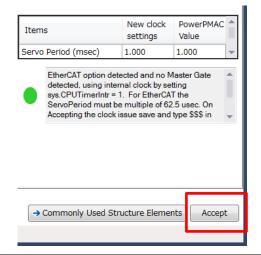

6 If you have changed the servo frequency setting, type the SAVE command in the Terminal tab page of Power PMAC IDE.
When complete, the "Save Complete" message appears in the Terminal tab page.

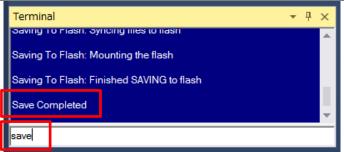


7 Click Delta Tau – Communication Setup on the toolbar to display the Device Properties dialog box.



In the Device Properties dialog box, select *No Device* for IP Address, then click the **Apply** button.

This operation sets the Controller to the offline state.

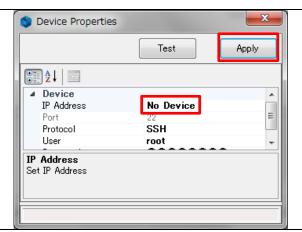

O The Controller restarts.


The servo frequency that has been set is reflected.

Wait until the startup process of the Controller is complete. Then click **Delta Tau** –

Communication Setup on the toolbar to display the Device Properties dialog box.

In the Device Properties dialog box, return the IP Address to the previous setting, then click the **Apply** button.

This operation sets the Controller to the online state.

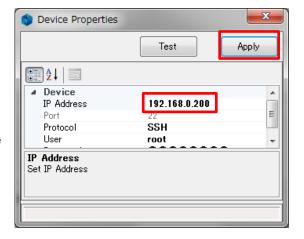

6.3. Installation of ESI Files


Install the ESI file for the Slave into Power PMAC IDE.



Precautions for Correct Use


Prepare the ESI file described in this section in advance. Contact your OMRON representative for information on how to procure the ESI file.

1 From the **EtherCAT** menu of Power PMAC IDE, select **ESI Manager**.

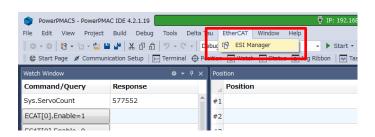

2 Confirm that Omron NX_Coupler.xml is registered in the ESI file list of ESI Manager.

If it is not yet registered, click **Add File** and register *Omron NX_Coupler.xml*.

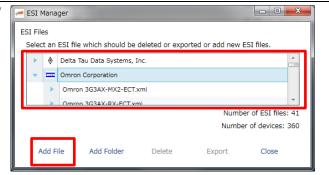



3 Click **Close** to close the ESI Manager.

6.4. EtherCAT Communications Setup

Set up EtherCAT communications.



Precautions for Correct Use

Before taking the following steps, make sure that the devices are connected via an Ethernet cable. If they are not connected, turn OFF the power to the devices, and connect the Ethernet cable.

6.4.1. Communications Setup for the EtherCAT Master


Connect the Controller with slave devices using an Ethernet cable. * Refer to the manuals for slave devices to configure them. Select System - EtherCAT in Solution Explorer ○ ○ ☆ ○ · □ /> rror the Solution Explorer and Search Solution Explorer (Ctrl+:) 0.00 rev right-click on EtherCAT, then PowerPMAC5 0.00 rev select Add EtherCAT System 0.00 rev CPU Master(Acontis). Hardware 0.00 rev **Ether**C Scope to This Motors New Solution Explorer View Coordinate Systems Encoder Properties Alt+Enter 🖢 C Language Add EtherCAT Master (Acontis) Configuration Master0 (Deactivated) is Solution Explorer added to Solution Explorer. ○ ○ △ ○ · □ /> -Search Solution Explorer (Ctrl+:) ۵ ☐ PowerPMAC5 System CPU Hardware EtherCAT Master0 (Deactivated) Coordinate Systems Encoder C Language Configuration Documentation PMAC Script Language

Solution Explorer Class View

In the Master tab page, specify a communication period for **Cycle**Time [us].

* You must specify the communication period in accordance with the servo frequency of the Controller.


1000 us is set in this document.

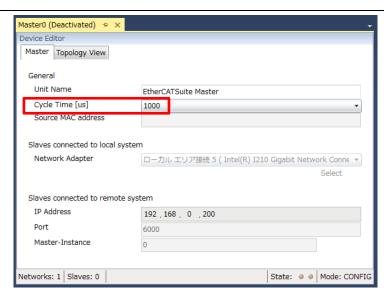


Correspondence between the servo frequencies of the Controller and communication periods is as follows:

4 kHz : 250 us 2 kHz : 500 us 1 kHz : 1000 us

5 Select System – EtherCAT in the Solution Explorer and right-click on Master0 (Deactivated), then select Scan EtherCAT Network.

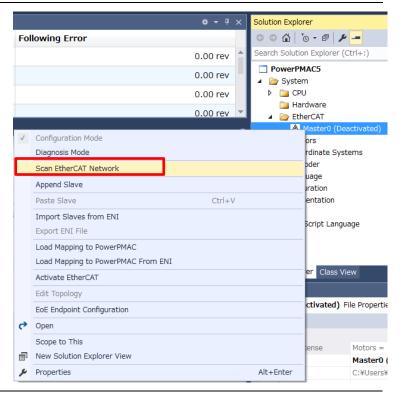

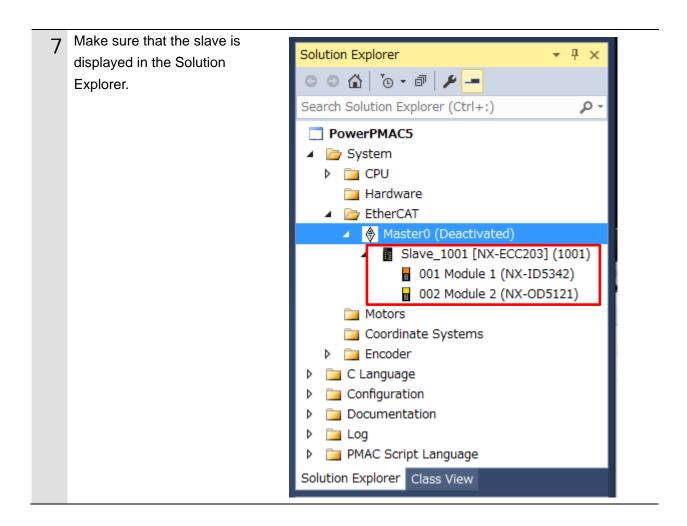

6.4.2. Distributed Clock Setup

Setting Distributed Clocks (DC) Solution Explorer for Master Gearch Solution Explorer (Ctrl+:) ۰ م PowerPMAC5 System In the Master0 (Deactivated) tab D 🗀 CPU Hardware page, select Distributed Clocks tab. 001 Module 1 (NX-ID5342) 002 Module 2 (NX-OD5121) Motors Coordinate Systems ▶ 🛅 Encoder CLanguage
Configuration Documentation Log PMAC Script Language Solution Explorer Class View Device Editor Master Topology View Proc Reference Clock Slave_1001 [NX-ECC203] (1001) Master Shift (EtherCAT Master Time controlled by Reference Clock) Bus Shift (Reference Clock controlled by EtherCAT Master Time) © External Mode (Reference Clock controlled by External Sync Device) Sync Window Monitoring Show 648it System Time Slave_1001 [NX-ECC203] (1001) Networks: 1 | Slaves: 1 | State: 0 0 Mode: CONFIG Select Master Shift (EtherCAT Device Editor Master | Topology View | Process Data Image | Variables | Advanced Options | Slave to Slave | Distributed Clocks | Tasks + Sync Units **Master Time controlled by** Reference Clock). Slave_1001 [NX-ECC203] (1001) Master Shift (EtherCAT Master Time controlled by Reference Clock) © External Mode (Reference Clock controlled by External Sync Device) Sync Window Monitoring Show 64Bit System Time

Slaves with active DC
Slave_1001 [NX-ECC203] (1001)


Networks: 1 | Slaves: 1


State: • • Mode: CONFIG

■ When using in DC mode


3 Setting Distributed Clock (DC) for the Slave

In the Project Explorer, select the target slave to display the Distributed Clock tab page.

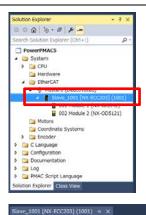

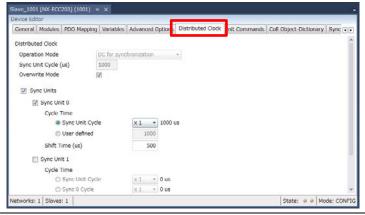

4 Select the **Overwrite Mode** check box and specify **Shift Time**.

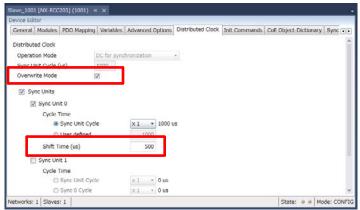


Correspondence between the servo frequencies of the Controller and **Shift Time** values is as follows:


4 kHz : 125 us 2 kHz : 250 us 1 kHz : 500 us

■ When using in Free-Run mode


3 Setting Distributed Clock (DC) for the Slave

In the Solution Explorer, select the target slave to display the Distributed Clock tab page.

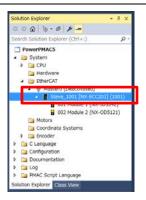

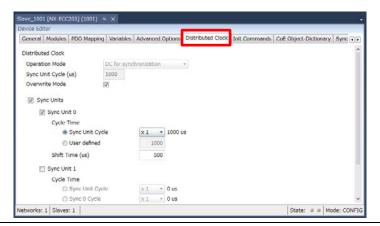


4 Select *FreeRun* from the drop down list for **Operation Mode**.

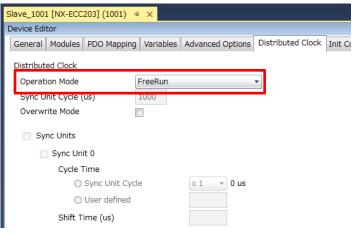


Display the Advanced Options tab page.

Clear the **Potential Reference Clock** check box.

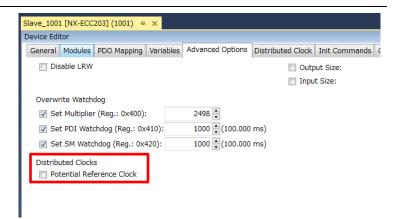

6.4.3. PDO Map Settings

1 In the Solution Explorer, select the target slave and display the PDO Mapping tab page.

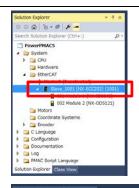




Setting PDO mapping (Inputs)

Confirm the check boxes in the Inputs field.


* If you do not want to use data in the Inputs field, clear the currently displayed check boxes.

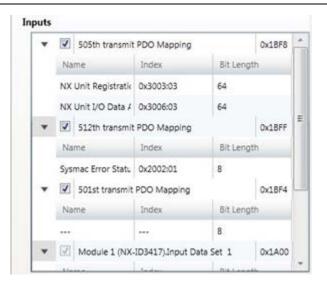

3 Setting PDO mapping (Outputs)


Confirm the check boxes in the Outputs field.

* If you do not want to use data in the Outputs field, clear the currently displayed check boxes.

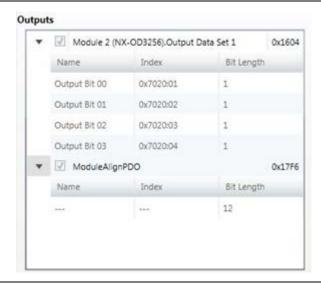


6.4.4. Creation of an EtherCAT Network Information File


1 Select System – EtherCAT in the Solution Explorer and right-click on Master0 (Deactivated), then select Load Mapping to PowerPMAC.

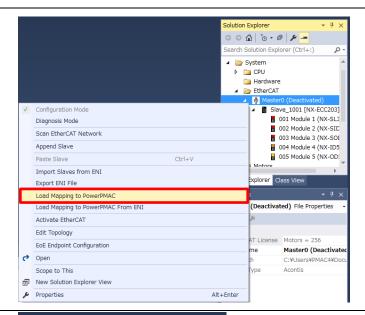

An eni.xml file is added under the **Configuration** directory in the Solution Explorer.

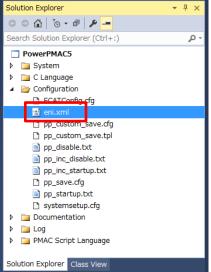

3 An ECATMap.pmh file is added under the PMAC Script Language/Global Includes directory in the Solution Explorer.

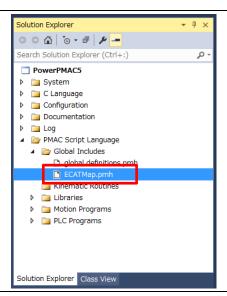


6.5. Controller Settings

6.5.1. EtherCAT Communications Check

Take the following steps to ensure that EtherCAT communications are available.


1 From the Terminal tab page, run the ECAT[0].Enable=1 command to start EtherCAT communications.

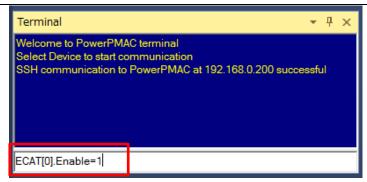

- 2 In the Terminal tab page or Watch Window, make sure that the ECAT[0]. Enable value turns to 1.
 - * The OP mode is entered and EtherCAT communications are established.

Watch Window	\$ → 1 ×
Command/Query	Response
Sys.ServoCount	12960793
ECAT[0].Enable	1

After making sure that correct communications are available, run the ECAT[0].Enable=0 command from the Terminal tab page to stop EtherCAT communications.

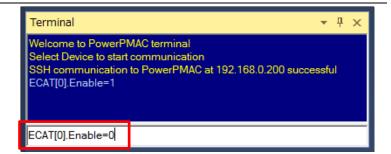


In the Terminal tab page or Watch Window, make sure that the ECAT[0]. Enable value turns to 0.

6.5.2. Writing the User Program

Create programs to be used to check operations.

A specific language is used for the operation check programs. Refer to *Power PMAC User's Manual* and *Power PMAC Software Reference Manual* for details.

1 In the Solution Explorer pane, open Project name – PMAC Script Language – PLC Programs – plc1.plc.

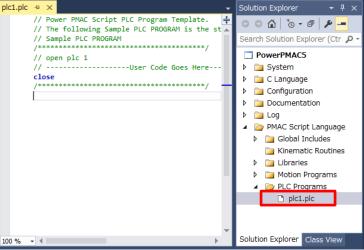

In the programming area of the plc1.plc tab page, write a program as show on the right.

This sample program blinks the NX-OD5121 output indicator every second.

* In this example, PDO mapping is assumed to be the default setting. If you want to change PDO mapping, rewrite the "Slave_0...." description.

```
open plc 1

while(sys.ecatMasterReady==0){};

ECAT[0].Enable=1;

P1000=Sys.Time+1;
while(P1000>Sys.Time){};

Slave_0_7022_1_OutputBit16bits = 1;


P1000=Sys.Time+1;
while(P1000>Sys.Time){};

Slave_0_7022_1_OutputBit16bits = 0;

close
```

3 Setting the start of the user program

In the Solution Explorer pane, open Project name – Configuration – pp_disable.txt.

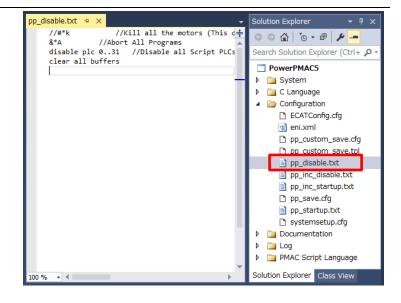

In the programming area of the pp_disable.txt tab page, add the program shown on the right to the last line.

enable plc 1;

The pp_disable.txt program is automatically executed when the Controller starts.

This example program runs the PLC1 script.

6.5.3. Project Data Transfer

Transfer the created project data to the Controller.

MARNING

When the user program and "configuration and setting" data are transferred from Power PMAC IDE, devices or the machine may perform unexpected operations. Therefore, before you transfer project data, ensure the destination slave is operating safely.




Transferring project data restarts the Controller and interrupts communications with slaves. The time that communications are interrupted depends on the EtherCAT network configuration.



Before you transfer project data, make sure that the slave settings will not adversely affect the devices.

1 In the Terminal tab page or Watch Window, make sure that the ECAT[0].Enable value is 0.

If the value is 1, run the ECAT[0].Enable=0 command from the Terminal tab page to stop EtherCAT communications.

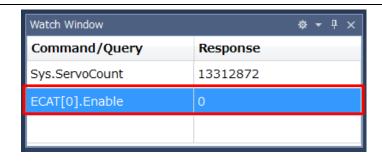

2 Downloading a project


Right-click the project name in the Solution Explorer pane on the upper right of the IDE screen, and select **Build and Download All Programs** to run the build and download.

* The transferred project is not yet saved to the Controller at this stage.

If you turn OFF the power to the Controller, the transferred project will be discarded.

- 3 Make sure that there are no errors in the Output Window.
 - * If the transfer fails, check details of the error in the Output Window.

If the error is a program error, you must review the program. If the error is related to EtherCAT settings, return to 6.4 EtherCAT Communications Setup and check whether there are any incorrect settings.

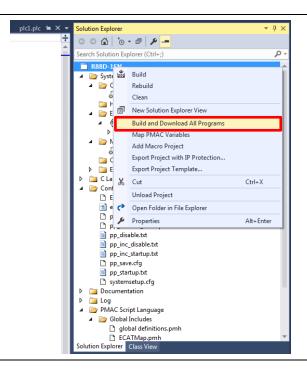


The program starts running when it has been downloaded successfully.

EtherCAT communications are in the OP state. Make sure that the NX-OD3256 output indicator blinks.

* If the indicator does not blink, check that the ECAT[0]. Enable value is 1 in the Terminal tab page or Watch Window.

If the value is 0, run the following command from the Terminal tab page.

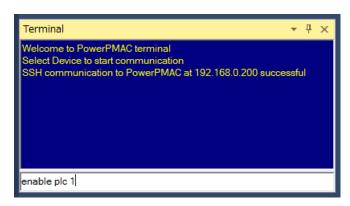


After you have confirmed an appropriate operation, save the project to the Controller.

enable plc 1

Run the save command from the Terminal tab page.


* The save command stores the downloaded project in the Controller. This operation saves the settings to be executed automatically when the power to the Controller is turned on.

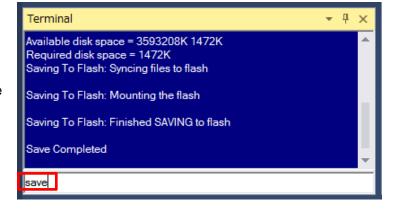


7. Appendix Saving and Loading a Project


The following describes the procedures to save a Power PMAC IDE project on the computer, and to reuse it.

7.1. Saving a Project

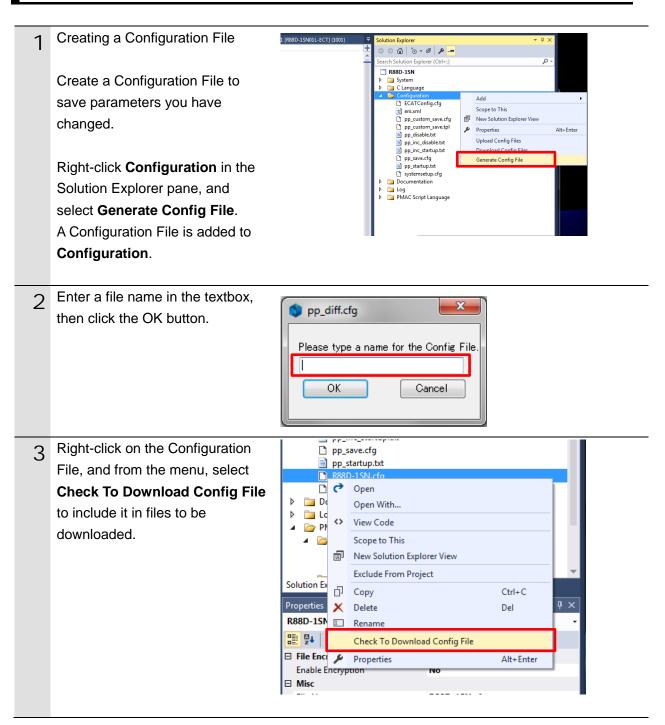

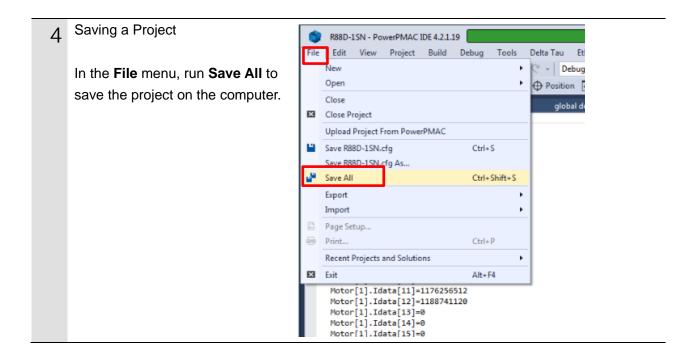


7.2. Loading and Downloading a Project

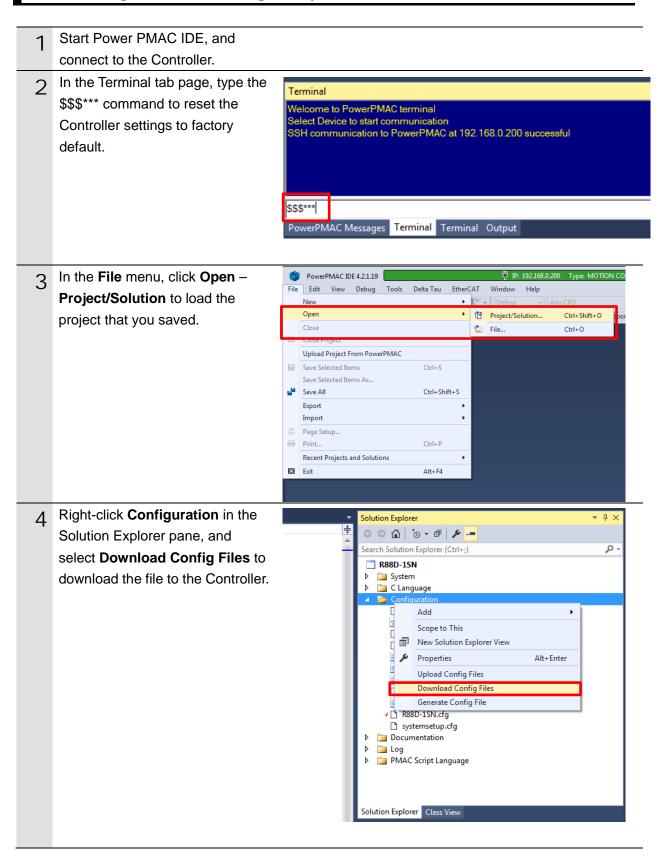

Right-click the project name in the Solution Explorer pane, and select **Build and Download All Programs** to run the build and download.


When the download process is complete, make sure that there are no errors in the Output tab Window.

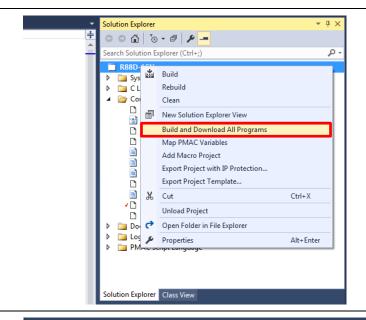

6 Stopping a program

If a program is running, execute the following command from the Terminal tab page to stop the program. Terminal

disable plc 1 ECAT[0].Enable=0

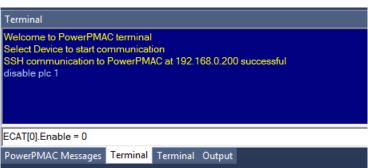

7 Saving the downloaded settings and programs

After the download process is complete and you make sure that there are no errors in the Output Window, run the save command from the Terminal tab page.

* The save command stores the downloaded project in the Controller. This operation saves the settings to be executed automatically when the power to the Controller is turned on.

Terminal


Welcome to PowerPMAC terminal
Select Device to start communication
SSH communication to PowerPMAC at 192.168.0.200 successful disable plc 1
ECAT[0].Enable = 0

save

PowerPMAC Messages Terminal Terminal Output

Restarting after download

Run the following command from the Terminal tab page to restart the Controller with the downloaded project. \$\$\$

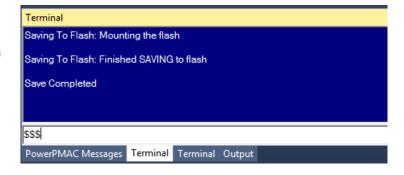

8. Appendix Troubleshooting


8.1. Factors Causing EtherCAT Communications To Be Unavailable, and Corrective Actions

Description	Factor	Corrective Action
The link is not established.	The Ethernet cable is broken or	If the Ethernet cable is broken
	the specified cable is not being	or if the specified cable was not
	used.	used, replace the cable.
	A connector on the Ethernet	Reconnect the connector and
	cable used for EtherCAT	make sure it is mated correctly.
	communications is	
	disconnected, the contact is	
	faulty, or parts are faulty.	
	A slave within the EtherCAT	Replace the slave.
	network configuration failed.	
EtherCAT communications do	ECAT[0].Enable is set to 0.	From the Terminal pane, run the
not start.		ECAT[0].Enable=1 command to
		start EtherCAT communications.
	The EtherCAT network	Review the settings according
	configuration in the Controller	to the procedures provided in
	does not agree with the	6.4 EtherCAT Communications
	physical network configuration.	Setup.
	The Ethernet cable is broken at	Connect the Ethernet cable
	a slave in the network, or a	correctly.
	connector is disconnected.	
	Some errors have occurred,	Check the ECAT[0].error value.
	and the ECAT[0].error is set to a	
	value other than 0.	
A synchronization error occurs	The distribution clock is not set	Review the settings according
at a slave.	correctly.	to the procedures provided in
	A slave in Free-Run Mode is set	6.4.2 Distributed Clock Setup.
	to the reference clock.	
	The servo task processing time	Review the program or servo
	exceeds the set period.	frequency to adjust it, so that
		the servo task processing time
		does not exceed the period.


8.2.1. Checking the EtherCAT Status

You can check the EtherCAT status from Diagnosis Mode of Power PMAC IDE.

Right-click on **Master0 (Deactivated)** under **EtherCAT** in the Solution Explorer, then select **Diagnosis Mode** to open the Diagnosis Mode page

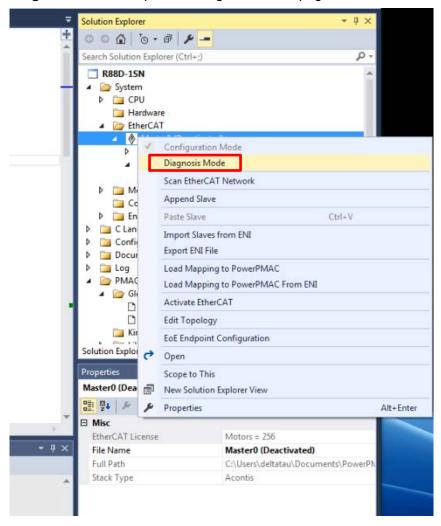

You can check the status of the slaves in the Diagnosis Mode page.

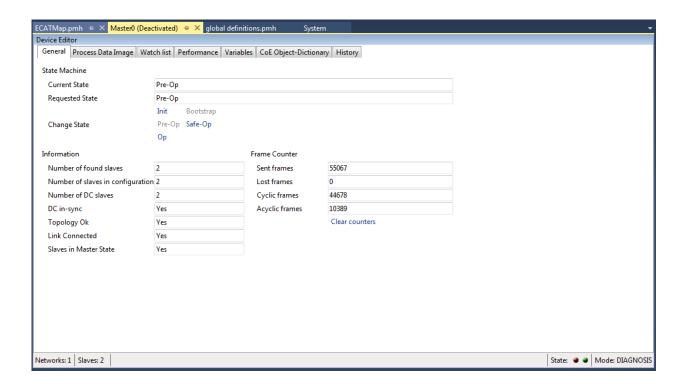

8.2.2. Checking the Controller Status

In the Status page of Power PMAC IDE, you can check the status of the motor, coordinate system, and system.

To display the Status page, click **Status** on the toolbar.

■ Global Status

You can check system errors such as the WDT error.




■ Motor Status

You can check deviation errors, limit errors, and other states of the motor.



■ Coordinate Status

You can check deviation errors, limit errors and other states of the coordinate system.

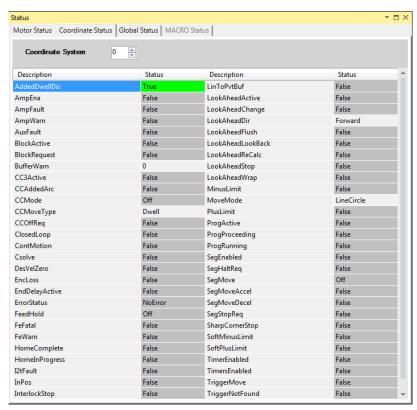

9. Appendix ECAT[i] Structure Elements

The Controller uses motion controller technology developed by Delta Tau Data Systems, Inc., (hereafter referred to as DT) in the U.S., however, the ECAT[i] structure elements differ from those of DT controllers. The following table shows the major changes that have been made from DT controllers.

Element name	Description	Change
ECAT[i].Enable	Enabling the EtherCAT	0: Disable, 1: Enable
	network	(2 and 3 are not supported.)
ECAT[i].LPIO[k]	Elements of low priority	Not supported
	I/O module	
ECAT[i].Slave[j]	Slave elements	Not supported
ECAT[i].Error	Error code of enabling	\$ 9811000C: Invalid network
	EtherCAT network	configuration
		\$ 9811002E: Disconnected network
		connection
ECAT[i].LinkUp	Status data structure	Not supported
ECAT[i].LPDomainOutputState	elements	
ECAT[i].LPDomainState		
ECAT[i].LPRxTime		
ECAT[i].LPTxTime		
ECAT[i].MasterStat		
ECAT[i].RTDomainOutputState		
ECAT[i].RTDomainState		

10. Revision History

Revision code	Revised date	Revised content
A	5-April, 2019	First edition

Note: Do not use this document to operate the Unit.

OMRON Corporation Industrial Automation Company

Tokyo, JAPAN

Contact: www.ia.omron.com

Regional Headquarters OMRON EUROPE B.V. Wegalaan 67-69, 2132 JD Hoofddorp The Netherlands Tel: (31)2356-81-300/Fax: (31)2356-81-388

OMRON ASIA PACIFIC PTE. LTD.

No. 438A Alexandra Road # 05-05/08 (Lobby 2), Alexandra Technopark, Singapore 119967 Tel: (65) 6835-3011/Fax: (65) 6835-2711

OMRON ELECTRONICS LLC 2895 Greenspoint Parkway, Suite 200 Hoffman Estates, IL 60169 U.S.A Tel: (1) 847-843-7900/Fax: (1) 847-843-7787

OMRON (CHINA) CO., LTD. Room 2211, Bank of China Tower,

200 Yin Cheng Zhong Road, PuDong New Area, Shanghai, 200120, China Tel: (86) 21-5037-2222/Fax: (86) 21-5037-2200

Authorized Distributor:

© OMRON Corporation 2019 All Rights Reserved. In the interest of product improvement, specifications are subject to change without notice.

Cat. No. 0041-E1-01 0419 (0419)